

# DART SERVICE BULLETIN SB12-1

AFFECTING:

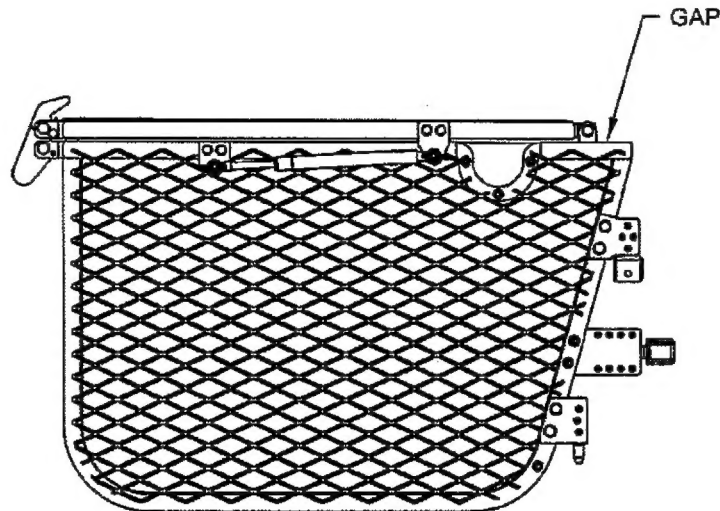
**D350-607-441/-443/-445/-447/-541/-543/-545/-547 HELI-UTILITY-BASKET  
INSTALLATIONS AT CHANGE 003 OR EARLIER**



REF TCCA STC: SH94-14  
FAA STC: SR00213NY  
REF EASA STC: 10016996  
REF ANAC STC'S: 2007S03-03/-04/-05/-06

Dart Aerospace Ltd. has received information indicating that under certain circumstances on **D350-607-441/-443/-445/-447/-541/-543/-545/-547** Heli-Utility-Basket Installations at **CHANGE 003 or earlier**, thin flexible objects such as an unsecured retaining strap can find their way out of the basket through the narrow opening located along the top inboard side of the basket base assembly and cause damage to the aircraft and/or depart from the basket in flight.

For operators with aircraft equipped with **D350-607-441/-443/-445/-447/-541/-543/-545/-547** Heli-Utility-Basket Installations at **CHANGE 003 or earlier** it is recommended that the opening described above be closed off with D4672-X Blanking Plates using the DSI 9618-011 Blanking Plate Kit (for D350-607-441/-443/-541/-543 Heli-Utility-Basket, Long) and DSI 9618-013 Blanking Plate Kit (for D350-607-445/-447/-545/-547 Heli-Utility-Basket, Short) per **DSI 9618 Rev. A** (or later approved revision).

Dart Aerospace Ltd. regrets any inconvenience this may cause.



A	NEW ISSUE	MB	12.06.25
REV.	DESCRIPTION	BY	DATE
DESIGN	 <b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	REV. A	
DRAWN		SHEET 1 OF 1	
CHECKED		DRAWING NO. SB12-1	
MFG. APPR.		TITLE	
APPROVED		SCALE	
DE APPR.	 <b>HELI-UTILITY-BASKET</b>	NTS	
DATE	12.06.25	<small>COPYRIGHT © 2012 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	